

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start		Rating **	A	Issue No.	7
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_RD0010_01_s _ 2013_7				
Comment Code					
Inspector Comment					
The O&M manual is located at Tom Schultz's house.					

No Photos

LM Start		Rating **	A	Issue No.	8
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_RD0010_01_s _ 2013_8				
Comment Code					
Inspector Comment					
Finlay Williams stated that they are part of the CO-OP with RD 784 which shares flood fight supplies at multiple locations. Also he has a small amount of supplies located at his house within the district.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start		Rating **	A	Issue No.	9	
LM End		Issue Type +	Ma	Location *	N/A	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Flood Preparedness & Training				°	
					°	
DWR ID	DWR_RD0010_01_s_2013_9					
Comment Code						
Inspector Comment						
The district has attended the class in the past and plans to attend the Flood Fight class put on by RD 784 and DWR.						

No Photos

LM Start	0.01	Rating **	A	Issue No.	29
LM End	7.62	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.163691 °	39.255746 °
				-121.609742 °	-121.574985 °
DWR ID	DWR_RD0010_01_f_2016_29				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Annual vegetation is well maintained. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_29\_20161031\_00069.jpg



View of well maintained annual vegetation on the landside looking upstream. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	0.01	Rating **	A	Issue No.	30
LM End	7.62	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.163690 °	39.255746 °
				-121.609742 °	-121.574985 °
DWR ID	DWR_RD0010_01_f_2016_30				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Annual vegetation is well maintained. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_30\_20161031\_00070.jpg



View of well maintained annual vegetation on the waterside looking upstream. Fall 2016.

LM Start	0.73	Rating **	A	Issue No.	68
LM End	0.73	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.161343°	39.161343°
				-121.596942°	-121.596942°
DWR ID	DWR_RD0010_01_s_2016_68				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Tree limbs have been trimmed to allow visibility and access. Fall 2016.					

No Photos

\* Location  
LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

\*\* Rating  
A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

+ Issue Type  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	1.36	Rating **	A	Issue No.	2
LM End	1.36	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.168769 °	39.168769 °
				-121.590409 °	-121.590409 °
DWR ID	DWR_RD0010_01_s_2016_2				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Tree limbs have been trimmed up for visibility and access. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_2\_20161031\_00071.jpg



View of tree that has been trimmed up for visibility and access on the landside. Fall 2016.

LM Start	1.49	Rating **	M	Issue No.	67
LM End	1.52	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.169221 °	39.169238 °
				-121.588073 °	-121.587550 °
DWR ID	DWR_RD0010_01_s_2016_67				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Small starter tree should be removed. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_67\_20161031\_00072.jpg



View of a small tree that needs to be removed on the land side slope looking upstream. Fall 2016.

\* Location  
LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

\*\* Rating  
A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

+ Issue Type  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	1.64	Rating **	M	Issue No.	66
LM End	1.64	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.169721°	39.169721°
				-121.585759°	-121.585759°
DWR ID	DWR_RD0010_01_s_2016_66				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Small trees should be trimmed up for visibility and access. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_66\_20161031\_00073.jpg



View of a small tree that needs to be trimmed for visibility and access on the land side slope looking upstream. Fall 2016.

LM Start	1.75	Rating **	M	Issue No.	65
LM End	1.75	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.171200 °	39.171200 °
				-121.585576 °	-121.585576 °
DWR ID	DWR_RD0010_01_s_2016_65				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Squirrel hole still are visible but no sign of activity, Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_65\_20161031\_00074.jpg



View of squirrel holes on the landside, no rodent activity was observed. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	1.81	Rating **	M	Issue No.	64
LM End	1.81	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.172094 °	39.172094 °
				-121.585472 °	-121.585472 °
DWR ID	DWR_RD0010_01_s_2016_64				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Squirrel hole still are visible but no sign of activity, Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_64\_20161031\_00075.jpg



View of squirrel holes on the landside, no rodent activity was observed. Fall 2016.

LM Start	2.09	Rating **	M	Issue No.	63
LM End	2.09	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.176153 °	39.176153 °
				-121.584958 °	-121.584958 °
DWR ID	DWR_RD0010_01_s_2016_63				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Squirrel hole still are visible but no sign of activity, Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_63\_20161031\_00076.jpg



View of squirrel holes on the landside, no rodent activity was observed. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	2.16	Rating **	M	Issue No.	61
LM End	2.38	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.177129°	39.180309°
				-121.584841°	-121.584451°
DWR ID	DWR_RD0010_01_s_2016_61				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Squirrel hole still are visible but no sign of activity, Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_61\_20161031\_00077.jpg



View of squirrel holes on the landside slope and toe, no rodent activity was observed. Fall 2016.

LM Start	2.56	Rating **	M	Issue No.	60
LM End	2.61	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.182940 °	39.183721 °
				-121.584115 °	-121.584019 °
DWR ID	DWR_RD0010_01_s_2016_60				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Squirrel hole still are visible but no sign of activity, Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_60\_20161031\_00078.jpg



View of squirrel holes on the landside slope and toe, no rodent activity was observed. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	2.63	Rating **	M	Issue No.	59
LM End	2.63	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.183967 °	39.183967 °
				-121.583989 °	-121.583989 °
DWR ID	DWR_RD0010_01_s_2016_59				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Squirrel hole still are visible but no sign of activity, Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_59\_20161031\_00079.jpg



View of squirrel holes on the landside slope and toe, no rodent activity was observed. Fall 2016.

LM Start	2.67	Rating **	M	Issue No.	58
LM End	2.67	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.184513 °	39.184513 °
				-121.583924 °	-121.583924 °
DWR ID	DWR_RD0010_01_s_2016_58				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Squirrel hole still are visible but no sign of activity, Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_58\_20161031\_00080.jpg



View of squirrel holes on the landside slope and toe, no rodent activity was observed. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	2.76	Rating **	M	Issue No.	57
LM End	2.76	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.185845 °	39.185845 °
				-121.583760 °	-121.583760 °
DWR ID	DWR_RD0010_01_s_2016_57				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Squirrel hole still are visible but no sign of activity, Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_57\_20161031\_00081.jpg



View of squirrel holes on the landside slope and toe, no rodent activity was observed. Fall 2016.

LM Start	3.01	Rating **	M	Issue No.	55
LM End	3.01	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.189497°	39.189497°
				-121.583308°	-121.583308°
DWR ID	DWR_RD0010_01_s_2016_55				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Small willow tree on landside slope should be removed. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_55\_20161031\_00082.jpg



View of small willow trees on the landside slope looking upstream. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	3.17	Rating **	M	Issue No.	54
LM End	3.17	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.191796°	39.191796°
				-121.583024°	-121.583024°
DWR ID	DWR_RD0010_01_s_2016_54				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Small willow tree on landside toe should be removed. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_54\_20161031\_00083.jpg



View of small willow trees on the landside toe looking upstream. Fall 2016.

LM Start	3.57	Rating **	C	Issue No.	28
LM End	7.64	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			39.197526 °	39.255993 °
				-121.582294 °	-121.574930 °
DWR ID	DWR_RD0010_01_f_2015_28				
Comment Code					
C1 : Add appropriate material and re-grade the levee to bring the crown above the design elevation.					
Inspector Comment					
Roadway crown has been re-rocked and grade for all weather surface. Fall 2016.					

No Photos

\* Location  
LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

\*\* Rating  
A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

+ Issue Type  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	3.69	Rating **	M	Issue No.	52
LM End	3.69	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.199095 °	39.199095 °
				-121.582118 °	-121.582118 °
DWR ID	DWR_RD0010_01_s_2016_52				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Squirrel hole still are visible but no sign of activity, Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_52\_20161031\_00085.jpg



View of squirrel holes on the landside slope and toe, no rodent activity was observed. Fall 2016.

LM Start	3.75	Rating **	U	Issue No.	51
LM End	3.75	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.200003 °	39.200003 °
				-121.582002 °	-121.582002 °
DWR ID	DWR_RD0010_01_s_2016_51				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
There is a large rodent hole the exceeds 2 cubic feet of dirt and needs to be properly backfilled. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_51\_20160906\_00017.jpg



View of large burrow on landside.

\* Location  
LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

\*\* Rating  
A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

+ Issue Type  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement



**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	3.87	Rating **	M	Issue No.	50
LM End	3.87	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.201825°	39.201825°
				-121.581779°	-121.581779°
DWR ID	DWR_RD0010_01_s_2016_50				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Squirrel hole still are visible but no sign of activity, Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_50\_20161031\_00086.jpg



View of squirrel holes on the landside slope and toe, no rodent activity was observed. Fall 2016.

LM Start	3.93	Rating **	M	Issue No.	47
LM End	3.93	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.202569°	39.202569°
				-121.581681°	-121.581681°
DWR ID	DWR_RD0010_01_s_2016_47				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Remove small willow tree from levee slope. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_47\_20161031\_00087.jpg



View of a small willow tree that should be removed on the landside looking down stream. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---



# Reclamation District No. 0010 Honcut

View of small starter willow trees on the landside looking upstream. Fall 2016.

View of squirrel holes on the landside slope and toe, no rodent activity was observed. Fall 2016.

Page 13 of 18

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	4.84	Rating **	M	Issue No.	45
LM End	4.84	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.215748 °	39.215748 °
				-121.580032 °	-121.580032 °
DWR ID	DWR_RD0010_01_s_2016_45				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Wild Rosebush on landside slope needs to be removed.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_45\_20161031\_00090.jpg



View of wild rosebush on the landside levee slope looking upstream. Fall 2016.

LM Start	4.92	Rating **	M	Issue No.	44
LM End	4.92	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.216850 °	39.216850 °
				-121.579896 °	-121.579896 °
DWR ID	DWR_RD0010_01_s_2016_44				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Wild Rosebush on landside slope needs to be removed. Fall 2016.					

No Photos

\* Location  
LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

\*\* Rating  
A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

+ Issue Type  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement

# Reclamation District No. 0010 Honcut

View of squirrel hole on landside toe, no sign of activity. Fall 2016.

View of multiple active ground squirrel holes on landside slope looking downstream.

Page 15 of 18

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	5.47	Rating **	M	Issue No.	40
LM End	5.64	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.224774°	39.227168°
				-121.578910°	-121.578615°
DWR ID	DWR_RD0010_01_s_2016_40				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Remove small willow trees from levee slope. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_40\_20161031\_00092.jpg



View of willow trees on the landside slope looking upstream. Fall 2016.

LM Start	6.18	Rating **	M	Issue No.	36
LM End	6.34	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.235067 °	39.237286 °
				-121.577541 °	-121.577218 °
DWR ID	DWR_RD0010_01_s_2016_36				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Large cluster of willows and wild rosebushes on landside slope & toe. Fall 2016.					

Photo 1 of 2 : FA\_2016\_RD0010\_163\_36\_20160906\_00013.jpg



View looking downstream landside of wild rosebushes that are blocking visibility at the toe. Spring 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable  N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	6.18	Rating **	M	Issue No.	36 (cont)
LM End	6.34	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.235067 °	39.237286 °
				-121.577541 °	-121.577218 °
DWR ID	DWR_RD0010_01_s_2016_36				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Large cluster of willows and wild rosebushes on landside slope & toe. Fall 2016.					

Photo 2 of 2 : FA\_2016\_RD0010\_163\_36\_20161031\_00093.jpg



View looking upstream landside of willows and wild rosebushes that are blocking visibility at the toe. Fall 2016.

LM Start	6.86	Rating **	M	Issue No.	34
LM End	6.86	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.244811 °	39.244811 °
				-121.576277 °	-121.576277 °
DWR ID	DWR_RD0010_01_s_2016_34				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Wild Rosebush on landside slope needs to be removed. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_163\_34\_20160906\_00012.jpg



View of thick wild rose bush that obstructs visibility of the landside slope and toe. Spring 2016.

\* Location  
LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

\*\* Rating  
A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

+ Issue Type  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/27/2016 10/27/2016	Sterling York

LM Start	7.27	Rating **	M	Issue No.	32
LM End	7.27	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.250651 °	39.250651 °
				-121.575579 °	-121.575579 °
DWR ID	DWR_RD0010_01_s_2016_32				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Small trees 4" in diameter at chest height should be removed before they get to big.					

Photo 1 of 2 : FA\_2016\_RD0010\_163\_32\_20160906\_00011.jpg



View of a tree that needs to be removed. Small trees 4" in diameter at chest height should be removed before they get to big. View of landside. Spring 2016.

LM Start	<b>7.27</b>	Rating **	M	Issue No.	<b>32 (cont)</b>
LM End	<b>7.27</b>	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : FA\_2016\_RD0010\_163\_32\_20161031\_00096.jpg



View of a tree that needs to be removed on the landside, looking downstream. Fall 2016.

**\* Location**

LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

**\*\* Rating**

A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

**+ Issue Type**

Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	0.01	Rating **	A	Issue No.	48
LM End	11.36	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.163770 °	39.309997 °
				-121.610047 °	-121.616383 °
DWR ID	DWR_RD0010_02_f_2016_48				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Well maintained annual vegetation. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_48\_20161031\_00068.jpg



View of well maintained annual vegetation on the waterside looking downstream. Fall 2016.

LM Start	0.01	Rating **	A	Issue No.	24
LM End	11.36	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.163770 °	39.309997 °
				-121.610047 °	-121.616382 °
DWR ID	DWR_RD0010_02_f_2016_24				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Well maintained annual vegetation. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_24\_20161031\_00069.jpg



View of well maintained annual vegetation on the landside looking downstream. Fall 2016.

**\* Location**

LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

**\*\* Rating**

A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

**+ Issue Type**

Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	0.38	Rating **	M	Issue No.	28
LM End	0.38	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.169231°	39.169231°
				-121.610711°	-121.610711°
DWR ID	DWR_RD0010_02_f_2015_28				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
No rodent activity but squirrel hole needs to be backfilled. Fall 2016.					

Photo 1 of 2 : FA\_2016\_RD0010\_164\_28\_20160906\_00007.jpg



View of the rodent hole on the waterward side of the levee looking upstream. Fall 2015.

LM Start	<b>0.38</b>	Rating **	M	Issue No.	<b>28 (cont)</b>
LM End	<b>0.38</b>	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : FA\_2016\_RD0010\_164\_28\_20161031\_00070.jpg



View of squirrel hole on the waterside looking downstream. Fall 2016

LM Start	0.77	Rating **	C	Issue No.	25
LM End	0.77	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.174722°	39.174722°
				-121.609874°	-121.609874°
DWR ID	DWR_RD0010_02_s_2016_25				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Tree limbs have been trimmed to allow access and visibility. Fall 2016.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain			



**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	0.80	Rating **	C	Issue No.	26
LM End	0.80	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.175195°	39.175195°
				-121.609854°	-121.609854°
DWR ID	DWR_RD0010_02_s_2016_26				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
The tire ruts have been fixed. Fall 2016.					

No Photos

LM Start	0.94	Rating **	U	Issue No.	29
LM End	0.94	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.177289 °	39.177289 °
				-121.609860 °	-121.609860 °
DWR ID	DWR_RD0010_02_f_2015_29				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					
Rodent hole that has more than 2 cubic feet of material needs to be properly backfilled. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_29\_20161031\_00072.jpg



View of rodent hole that has more than 2 cubic feet of material on the waterside. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	1.13	Rating **	M	Issue No.	30
LM End	1.13	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.179947 °	39.179947 °
				-121.610024 °	-121.610024 °
DWR ID	DWR_RD0010_02_f_2015_30				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Rodent hole needs to be properly backfilled. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_30\_20161031\_00073.jpg



View of rodent hole on waterside levee slope. Fall 2016.

LM Start	1.86	Rating **	M	Issue No.	40
LM End	1.86	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.190429 °	39.190429 °
				-121.607823 °	-121.607823 °
DWR ID	DWR_RD0010_02_s_2016_40				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	2.71	Rating **	C	Issue No.	41
LM End	2.71	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.202553 °	39.202553 °
				-121.609390 °	-121.609390 °
DWR ID	DWR_RD0010_02_s_2016_41				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Tree has been removed from the landside, looking upstream. Fall 2016					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	3.29	Rating **	C	Issue No.	43
LM End	3.29	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			39.210950 °	39.210950 °
				-121.610173 °	-121.610173 °
DWR ID	DWR_RD0010_02_s_2016_43				
Comment Code					
C1 : Add appropriate material and re-grade the levee to bring the crown above the design elevation.					
Inspector Comment					
The levee crown has been re-rocked. Fall 2016.					

No Photos

LM Start	3.60	Rating **	M	Issue No.	7
LM End	3.60	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.215338 °	39.215338 °
				-121.610751 °	-121.610751 °
DWR ID	DWR_RD0010_02_s_2016_7				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Rodent hole needs to be properly backfilled. Fall 2016.					

Photo 1 of 3 : FA\_2016\_RD0010\_164\_7\_20160906\_00001.jpg



Marker visible on waterward side.

Photo 2 of 3 : FA\_2016\_RD0010\_164\_7\_20160906\_00002.jpg



View of waterward slope--burrow activity present.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	3.60	Rating **	M	Issue No.	7 (cont)	
LM End	3.60	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Animal Control			39.215338 °		39.215338 °
				-121.610751 °		-121.610751 °
DWR ID	DWR_RD0010_02_s_2016_7					
Comment Code						
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.						
Inspector Comment						
Rodent hole needs to be properly backfilled. Fall 2016.						

Photo 3 of 3 : FA\_2016\_RD0010\_164\_7\_20160906\_00003.jpg

Could Not Find Photo

Flap gate located on waterward side--debris blocking gate.

LM Start	3.65	Rating **	M	Issue No.	68
LM End	3.65	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.216059 °	39.216059 °
				-121.610815 °	-121.610815 °
DWR ID	DWR_RD0010_02_f_2013_68				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
No rodent activity but holes need to be properly backfilled. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_68\_20161031\_00079.jpg



View of rodent holes on waterside slope. Fall 2016.

LM Start	3.86	Rating **	C	Issue No.	44
LM End	3.86	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.219160 °	39.219160 °
				-121.610617 °	-121.610617 °
DWR ID	DWR_RD0010_02_s_2016_44				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Tree in this location has been removed. Fall 2016.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	4.63	Rating **	C	Issue No.	46
LM End	4.63	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.229535 °	39.229535 °
				-121.612983 °	-121.612983 °
DWR ID	DWR_RD0010_02_s_2016_46				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Large patch of wild growth, blackberries on landward toe should be removed.					

No Photos

LM Start	5.20	Rating **	M	Issue No.	50
LM End	5.20	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.237272 °	39.237272 °
				-121.615424 °	-121.615424 °
DWR ID	DWR_RD0010_02_f_2016_50				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
No rodent activity but holes need to be properly backfilled. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_50\_20161031\_00087.jpg



View of rodent hole on landside slope. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	6.14	Rating **	M	Issue No.	47
LM End	6.14	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.250427°	39.250427°
				-121.619196°	-121.619196°
DWR ID	DWR_RD0010_02_s_2016_47				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Remove small starter tree. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_47\_20161031\_00088.jpg



View of a small tree at the toe of the landside. Fall 2016.

LM Start	6.72	Rating **	M	Issue No.	32
LM End	6.72	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.257859 °	39.257859 °
				-121.617667 °	-121.617667 °
DWR ID	DWR_RD0010_02_f_2015_32				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
No rodent activity but holes need to be properly backfilled. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_32\_20161031\_00092.jpg



View of rodent holes on waterside levee slope. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	6.88	Rating **	U	Issue No.	33
LM End	6.88	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.259843 °	39.259843 °
				-121.616013 °	-121.616013 °
DWR ID	DWR_RD0010_02_f_2015_33				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Rodent hole that has more than 2 cubic feet of material, this hole is not active but needs to be backfilled properly. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_33\_20161031\_00094.jpg



View of rodent hole that has more than 2 cubic feet of material, this hole is not active but needs to be backfilled properly. Fall 2016.

LM Start	7.58	Rating **	M	Issue No.	56
LM End	7.58	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.269021 °	39.269021 °
				-121.611377 °	-121.611377 °
DWR ID	DWR_RD0010_02_s_2016_56				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Remove small willows from levee toe. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_56\_20161102\_00100.jpg



View of small willows at landside levee toe looking downstream. Fall 2016.

**\* Location**

LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

**\*\* Rating**

A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

**+ Issue Type**

Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	7.74	Rating **	C	Issue No.	57
LM End	7.74	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.271353°	39.271353°
				-121.611386°	-121.611386°
DWR ID	DWR_RD0010_02_s_2016_57				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Trees have been trimmed up. Fall 2016.					

No Photos

LM Start	7.78	Rating **	M	Issue No.	59
LM End	7.78	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.271861 °	39.271861 °
				-121.611702 °	-121.611702 °
DWR ID	DWR_RD0010_02_s_2016_59				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Trim tree up 5' for access and visibility. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_59\_20161102\_00104.jpg



View of a tree on landside looking downstream that needs to be trimmed up 5' for access and visibility. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---



# Reclamation District No. 0010 Honcut

View of rodent hole on waterside. Fall 2016.

No Photos

No Photos

Page 11 of 16

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	9.02	Rating **	M	Issue No.	66
LM End	9.02	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.282329 °	39.282329 °
				-121.600161 °	-121.600161 °
DWR ID	DWR_RD0010_02_s_2016_66				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Willow tree at toe should be removed. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_66\_20161103\_00109.jpg



View of small willow tree on the landside toe looking downstream that should be removed. Fall 2016.

LM Start	9.34	Rating **	C	Issue No.	27
LM End	9.34	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			39.286983 °	39.286983 °
				-121.600423 °	-121.600423 °
DWR ID	DWR_RD0010_02_s_2015_27				
Comment Code					
C1 : Add appropriate material and re-grade the levee to bring the crown above the design elevation.					
Inspector Comment					
New rock has been added to the crown and ruts no longer exist. Fall 2016.					

No Photos

\* Location  
LS : Land Side N/A : Not Applicable  
WS : Water Side  
CR : Crown

\*\* Rating  
A : Acceptable N : Not Inspected/Rated  
M : Minimally Acceptable C : Corrected  
U : Unacceptable A/W : Acceptable but Monitor & Maintain

+ Issue Type  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	9.94	Rating **	M	Issue No.	70
LM End	9.94	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.293633 °	39.293633 °
				-121.606986 °	-121.606986 °
DWR ID	DWR_RD0010_02_s_2016_70				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Trim tree up five feet for visibility and access. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_70\_20161103\_00114.jpg



View of tree on landside toe that need to be trimmed up five feet for visibility and access. Fall 2016.

LM Start	9.95	Rating **	M	Issue No.	72
LM End	10.30	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.293740°	39.296901°
				-121.607210°	-121.612145°
DWR ID	DWR_RD0010_02_s_2016_72				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Blackberry bushes have been sprayed/burned, but need to removed. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_72\_20161103\_00116.jpg



View of landside looking downstream at Blackberry bushes that have been sprayed/burned, but need to removed. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	10.32	Rating **	M	Issue No.	73
LM End	10.32	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.297091°	39.297091°
				-121.612366°	-121.612366°
DWR ID	DWR_RD0010_02_s_2016_73				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Blackberries on landward slope should be removed.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_73\_20161103\_00117.jpg



View of landside slope looking downstream where blackberry bushes have been sprayed and burned but need to be removed. Fall 2016.

LM Start	10.48	Rating **	M	Issue No.	75
LM End	10.63	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.298762 °	39.300083 °
				-121.614394 °	-121.616614 °
DWR ID	DWR_RD0010_02_s_2016_75				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Tree has been trimmed up but small starter trees should be removed. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_75\_20161103\_00118.jpg



View of landside looking downstream where the tree has been trimmed up but small starter trees should be removed. Fall 2016.

\* Location  
LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

\*\* Rating  
A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

+ Issue Type  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement



# Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/27/2016 10/27/2016	Sterling York

LM Start	10.70	Rating **	M	Issue No.	76
LM End	10.70	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.300866 °	39.300866 °
				-121.617510 °	-121.617510 °
DWR ID	DWR_RD0010_02_s _ 2016_76				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					
Wild growth on waterside slope should be removed. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_76\_20161103\_00119.jpg



View looking downstream at wild growth on waterside slope that needs to be removed. Fall 2016.

LM Start	10.79	Rating **	M	Issue No.	77
LM End	10.79	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.302055 °	39.302055 °
				-121.617730 °	-121.617730 °
DWR ID	DWR_RD0010_02_s _ 2016_77				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Small tree on slope should be removed. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_164\_77\_20161103\_00120.jpg



View looking downstream of a small tree on landside slope that should be removed. Fall 2016.

* Location	** Rating	+ Issue Type
LS : Land Side    N/A : Not Applicable	A : Acceptable                      N : Not Inspected/Rated	Ma : Maintenance Deficiency
WS : Water Side	M : Minimally Acceptable        C : Corrected	Ob : Design & System Obsolescence
CR : Crown	U : Unacceptable                  A/W : Acceptable but Monitor & Maintain	En : Enforcement



**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Honcut Creek	Left	2.81	10/27/2016 10/27/2016	Sterling York

LM Start	0.00	Rating **	A	Issue No.	4
LM End	2.80	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.310027°	39.298538°
				-121.616346°	-121.569911°
DWR ID	DWR_RD0010_03_f_2016_4				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Well maintained annual vegetation. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_165\_4\_20161103\_00011.jpg



View of the well maintained vegetation on the waterside looking downstream. Fall 2016.

LM Start	0.00	Rating **	A	Issue No.	5
LM End	2.80	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.310027°	39.298538°
				-121.616346°	-121.569911°
DWR ID	DWR_RD0010_03_f_2016_5				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Well maintained annual vegetation. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_165\_5\_20161103\_00010.jpg



View of the well maintained vegetation on the landside looking downstream. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Honcut Creek	Left	2.81	10/27/2016 10/27/2016	Sterling York

LM Start	1.48	Rating **	C	Issue No.	9
LM End	1.48	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.303774 °	39.303774 °
				-121.591847 °	-121.591847 °
DWR ID	DWR_RD0010_03_s_2016_9				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
The small cluster of trees that where at this location have been removed. Fall 2016.					

No Photos

LM Start	1.67	Rating **	C	Issue No.	18
LM End	1.67	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.302904 °	39.302904 °
				-121.588578 °	-121.588578 °
DWR ID	DWR_RD0010_03_f_2013_18				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
No agricultural tilling. The cut at the levee toe has been repaired. Fall 2016.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2016

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Honcut Creek	Left	2.81	10/27/2016 10/27/2016	Sterling York

LM Start	1.72	Rating **	M	Issue No.	6
LM End	1.72	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.303262 °	39.303262 °
				-121.587680 °	-121.587680 °
DWR ID	DWR_RD0010_03_f _ 2016_6				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
No squirrel activity seen, but rodent holes need to be back filled properly. Fall 2016.					

Photo 1 of 1 : FA\_2016\_RD0010\_165\_6\_20161103\_00015.jpg



View of waterside slope, no squirrel activity seen, but rodent holes need to be back filled properly. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---